



Submitted to
Dynergy Midwest Generation,
LLC
1500 Eastport Plaza Drive
Collinsville, IL 62234

Submitted by
AECOM
1001 Highlands Plaza Drive West
Suite 300
St. Louis, MO 63110

October 2016

CCR Rule Report: Initial Structural Stability Assessment

For

East Ash Pond

At Havana Power Station

1 Introduction

This Coal Combustion Residual (CCR) Rule Report documents that the East Ash Pond at the Dynegy Midwest Generation, LLC Havana Power Station meets the structural stability assessment requirements specified in 40 Code of Federal Regulations (CFR) §257.73(d), except as noted herein. The East Ash Pond is located near Havana, Illinois in Mason County, approximately 0.2 miles east of the Havana Power Station. The East Ash Pond serves as the wet impoundment basin for CCR materials produced by the Havana Power Station.

The East Ash Pond is an existing CCR surface impoundment as defined by 40 CFR §257.53. The CCR Rule requires that an initial structural stability assessment for an existing CCR surface impoundment be completed by October 17, 2016. In general, the initial structural stability assessment must document that the design, construction, operation, and maintenance of the CCR unit is consistent with recognized and generally accepted good engineering practices.

The owner or operator of the CCR unit must obtain a certification from a qualified professional engineer stating that the initial structural stability assessment was conducted in accordance with the requirements of 40 CFR § 257.73(d). The owner or operator must prepare a periodic structural stability assessment every five years.

2 Initial Structural Stability Assessment

40 CFR §257.73(d)(1)

The owner or operator of the CCR unit must conduct initial and periodic structural stability assessments and document whether the design, construction, operation, and maintenance of the CCR unit is consistent with recognized and generally accepted good engineering practices for the maximum volume of CCR and CCR wastewater which can be impounded therein. The assessment must, at a minimum, document whether the CCR unit has been designed, constructed, operated, and maintained with [the standards in (d)(1)(i)-(vii)].

An initial structural stability assessment has been performed to document that the design, construction, operation and maintenance of the East Ash Pond is consistent with recognized and generally accepted good engineering practices. The results of the structural stability assessment are discussed in the following sections. Based on the assessment and its results, the design, construction, operation, and maintenance of the East Ash Pond were found to be consistent with recognized and generally accepted good engineering practices, and meets the standards in 257.73(d)(1)(i)-(vii), except as noted herein.

2.1 Foundations and Abutments (§257.73(d)(1)(i))

CCR unit designed, constructed, operated, and maintained with stable foundations and abutments.

The stability of the foundations was evaluated using soil data from field investigations and reviewing design drawings, operational and maintenance procedures, and conditions observed in the field by AECOM. Additionally, slope stability analyses were performed to evaluate slip surfaces passing through the foundations. The East Ash Pond is a ring dike structure and does not have abutments.

The foundation consists of very loose to medium dense soil. Slope stability analyses exceed the criteria listed in §257.73(e)(1) for slip surfaces passing through the foundation. The slope stability analyses are discussed in the *CCR Rule Report: Initial Safety Factor Assessment for East Ash Pond at Havana Power Station* (October 2016). Additional slope stability analyses were performed to evaluate the effects of liquefaction in the foundation and were found to satisfy the criteria in §257.73(e)(1)(iv) applicable to dikes. A review of operational and maintenance procedures as well as current and past performance of the dikes has determined appropriate processes are in place for continued operational performance.

Based on the conditions observed by AECOM, the East Ash Pond was designed and constructed with stable foundations. Operational and maintenance procedures are in place to address any issues related to the stability of foundations. Therefore, the East Ash Pond meets the requirements in §257.73(d)(1)(i).

2.2 Slope Protection (§257.73(d)(1)(ii))

CCR unit designed, constructed, operated, and maintained with adequate slope protection to protect against surface erosion, wave action and adverse effects of sudden drawdown.

The adequacy of slope protection was evaluated by reviewing design drawings, operational and maintenance procedures, and conditions observed in the field by AECOM.

Based on this evaluation, adequate slope protection was designed and constructed at the East Ash Pond. No evidence of significant areas of erosion or wave action was observed. The interior slopes are protected with either concrete revetment or a geomembrane liner and the exterior slopes are protected with vegetation and some limited areas of crushed stone. The geomembrane liner or concrete revetment on the interior slopes isolates the

embankment soils from surface erosion, wave action, and the adverse effects of sudden drawdown. Operational and maintenance procedures to repair the vegetation (exterior slopes), concrete revetment, and liner (interior slopes) as needed are appropriate to protect against surface erosion or wave action. Therefore, the East Ash Pond meets the requirements in §257.73(d)(1)(ii).

2.3 Dike Compaction (§257.73(d)(1)(iii))

CCR unit designed, constructed, operated, and maintained with dikes mechanically compacted to a density sufficient to withstand the range of loading conditions in the CCR unit.

The density of the dike materials was evaluated using soil data from field investigations and reviewing design drawings, operational and maintenance procedures, and conditions observed in the field by AECOM. Additionally, slope stability analyses were performed to evaluate slip surfaces passing through the dike over the range of expected loading conditions as defined within §257.73(e)(1).

Based on this evaluation, the dike consists of medium dense to very dense material, with some isolated zones of loose sand, which is indicative of mechanically compacted dikes. Slope stability analyses exceed the criteria listed in §257.73(e)(1) for slip surfaces passing through the dike. The slope stability analyses are discussed in the *CCR Rule Report: Initial Safety Factor Assessment for East Ash Pond at Havana Power Station* (October 2016); therefore, the original design and construction of the East Ash Pond included sufficient dike compaction. Operational and maintenance procedures are in place to identify and mitigate deficiencies in order to maintain sufficient compaction of the dikes to withstand the range of loading conditions. Therefore, the East Ash Pond meets the requirements in §257.73(d)(1)(iii).

2.4 Vegetated Slopes (§257.73(d)(1)(iv))¹

CCR unit designed, constructed, operated, and maintained with vegetated slopes of dikes and surrounding areas, except for slopes which have an alternate form or forms of slope protection.

The adequacy of slope vegetation was evaluated by reviewing design drawings, operational and maintenance procedures, and conditions observed in the field by AECOM.

Based on this evaluation, the vegetation on the exterior slopes is adequate as no substantial bare or overgrown areas were observed. Exposed geomembrane liners or concrete revetment on the interior slopes are used as an alternate form of slope protection, which is adequate as significant tears or defects were not observed. Therefore, the original design and construction of the East Ash Pond included adequate vegetation of the dikes and surrounding areas. Adequate operational and maintenance procedures are in place to regularly manage vegetation growth, including mowing and seeding any bare areas, as evidenced by the conditions observed by AECOM. Therefore, the East Ash Pond meets the requirements in §257.73(d)(1)(iv).

¹ As modified by court order issued June 14, 2016, *Utility Solid Waste Activities Group v. EPA*, D.C. Cir. No. 15-1219 (order granting remand and vacatur of specific regulatory provisions).

2.5 Spillways (§257.73(d)(1)(v))

CCR unit designed, constructed, operated, and maintained with a single spillway or a combination of spillways configured as specified in [paragraph (A) and (B)]:

(A) All spillways must be either:

- (1) of non-erodible construction and designed to carry sustained flows; or*
- (2) earth- or grass-lined and designed to carry short-term, infrequent flows at non-erosive velocities where sustained flows are not expected.*

(B) The combined capacity of all spillways must adequately manage flow during and following the peak discharge from a:

- (1) Probable maximum flood (PMF) for a high hazard potential CCR surface impoundment; or*
- (2) 1000-year flood for a significant hazard potential CCR surface impoundment; or*
- (3) 100-year flood for a low hazard potential CCR surface impoundment.*

The spillways were evaluated using design drawings, operational and maintenance procedures, and conditions observed in the field by AECOM. Additionally, hydrologic and hydraulic analyses were completed to evaluate the capacity of the spillway relative to inflow estimated for the Probable Maximum Flood (PMF) event for the high hazard potential East Ash Pond. The hazard potential classification assessment was performed by Stantec in 2016 in accordance with §257.73(a)(2).

Both a primary and emergency spillway are present at the East Ash Pond. The primary spillway is comprised of a reinforced concrete riser structure with a reinforced concrete outlet pipe while the emergency spillway is comprised of a concrete lined overflow channel on the embankment crest and a riprap lined chute on the downstream face of the embankment. The reinforced concrete and riprap are non-erodible materials designed to carry sustained flows. The capacity of the spillways was evaluated using hydrologic and hydraulic analysis performed per §257.82(a). The analysis found that the primary spillway alone can adequately manage flow during peak discharge resulting from the PMF storm event without overtopping of the embankments. The emergency spillway is not activated during the IDF. The hydrologic and hydraulic analyses are discussed in the *CCR Rule Report: Initial Inflow Design Flood Control System Plan for East Ash Pond at Havana Power Station* (October 2016). Operational and maintenance procedures are in place to repair any issues with the spillways and remove debris or other obstructions from the spillways, as evidenced by the conditions observed by AECOM. As a result, these procedures are appropriate for maintaining the spillways. Therefore, the East Ash Pond meets the requirements in §257.73(d)(1)(v).

2.6 Stability and Structural Integrity of Hydraulic Structures (§257.73(d)(1)(vi))

CCR unit designed, constructed, operated, and maintained with hydraulic structures underlying the base of the CCR unit or passing through the dike of the CCR unit that maintain structural integrity and are free of significant deterioration, deformation, distortion, bedding deficiencies, sedimentation, and debris which may negatively affect the operation of the hydraulic structure.

One hydraulic structure passes through the dike of the East Ash Pond, the primary spillway reinforced concrete outlet pipe. The stability and structural integrity of the outlet pipe was evaluated using design drawings, operational and maintenance procedures, inspections, and conditions observed in the field by AECOM. No other hydraulic structures are known to pass through the dike of or underlie the base of the East Ash Pond.

The evaluation of design drawings and operational and maintenance procedures and conditions observed in the field did not identify any issues with the outlet pipe. However, the evaluation of the stability and structural integrity of the outlet pipe has not been fully completed because of access issues which prevented a closed-circuit television (CCTV) inspection of the outlet pipe. An inspection was attempted on July 20, 2016, but the CCTV rover was unable to traverse several abrupt grade changes within the outlet pipe.

Based on this evaluation, the hydraulic structure cannot be certified to meet the requirements of §257.73(d)(1)(vi), because a CCTV inspection of the outlet pipe has not yet been performed, thus, precluding completion of the evaluation of the stability and structural integrity of the pipe. In accordance with §257.73(d)(2), AECOM

recommends that a CCTV pipe inspection of the outlet pipe be completed as soon as feasible and that this assessment be updated once the inspection is completed.

2.7 Downstream Slope Inundation/Stability (§257.73(d)(1)(vii))

CCR unit designed, constructed, operated, and maintained with, for CCR units with downstream slopes which can be inundated by the pool of an adjacent water body, such as a river, stream or lake, downstream slopes that maintain structural stability during low pool of the adjacent water body or sudden drawdown of the adjacent water body.

The structural stability of the downstream slopes of the East Ash Pond was evaluated by comparing the location of the East Ash Pond relative to adjacent water bodies using published Federal Emergency Management Agency (FEMA) Flood Insurance Rate Maps (FIRMs), aerial imagery, and conditions observed in the field by AECOM.

Based on this evaluation, water bodies adjacent to the downstream slopes of the East Ash Pond are not present. The nearest downstream water body is the Illinois River. However, as shown on the FEMA FIRM for the area, the 100-year flood zone is beyond the downstream slopes of the East Ash Pond. Therefore, adjacent water bodies that can inundate the downstream slopes of the East Ash Pond are not present.

Based on this evaluation, the requirements in §257.73(d)(1)(vii) are not applicable to the East Ash Pond, as inundation of the downstream slopes is not expected to occur.


3 Certification Statement

CCR Unit: Dynegy Midwest Generation, LLC; Havana Power Station; East Ash Pond

I, Victor A. Modeer, PE, being a Registered Professional Engineer in good standing in the State of Illinois, do hereby certify, to the best of my knowledge, information, and belief that the information contained in this CCR Rule Report, and the underlying data in the operating record, has been prepared in accordance with the accepted practice of engineering. I certify, for the above-referenced CCR Unit, that the initial structural stability assessment dated October 13, 2016 was conducted in accordance with the requirements of 40 CFR § 257.73(d).

VICTOR A MODEER SR
Printed Name

10/13/16
Date

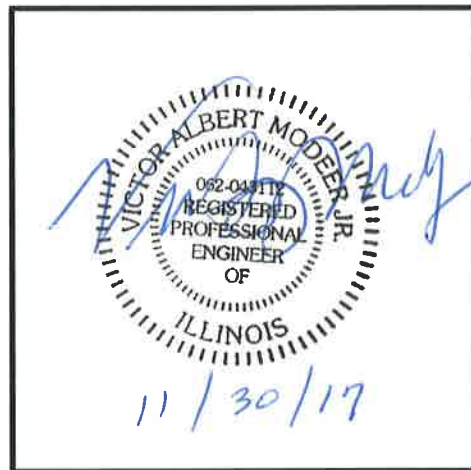

About AECOM

AECOM (NYSE: ACM) is a global provider of professional technical and management support services to a broad range of markets, including transportation, facilities, environmental, energy, water and government. With nearly 100,000 employees around the world, AECOM is a leader in all of the key markets that it serves. AECOM provides a blend of global reach, local knowledge, innovation, and collaborative technical excellence in delivering solutions that enhance and sustain the world's built, natural, and social environments. A Fortune 500 company, AECOM serves clients in more than 100 countries and has annual revenue in excess of \$19 billion.

More information on AECOM and its services can be found at www.aecom.com.

1001 Highlands Plaza Drive West
Suite 300
St. Louis, MO 63110
1-314-429-0100